

FORD:

2003-2004 Crown Victoria

LINCOLN:

2003-2004 Town Car

MERCURY:

2003-2004 Grand Marquis

This article supersedes TSB **04-21-11** to update the calibration information and model coverage.

ISSUE

Some 2003-2004 Crown Victoria, Grand Marquis/Marauder, Town Car vehicles may exhibit a malfunction indicator lamp (MIL) on along with diagnostic trouble code (DTC) P0460 stored in continuous memory.

ACTION

If DTC P0460 is the only code present, reprogram the powertrain control module (PCM) to the latest calibration using WDS release B35.7 or higher. Calibration files may also be obtained at www.motorcraft.com. Do not replace any fuel level input (FLI) or fuel pump components.

If DTC P0460 is present with P0462 and/or P0463, reprogram the powertrain control module (PCM). If DTCs P0462 or P0463 are still present after reprogramming the PCM, follow normal diagnostics.

WARRANTY STATUS: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage

OPERATION	DESCRIPTION	TIME
051103A	2003-2004 Crown Victoria, Grand Marquis/Marauder, Town Car: Check For Diagnostic Trouble Coded And Reprogram Powertrain Control Module (Do Not Use With 12650D, 12650D84)	0.4 Hr.

DEALER CODING

BASIC PART NO.
RECALEM

CONDITION
CODE
04

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.